
Alarm code	82	Liquid Refrigerant Pipe Thermistor(TL) abnormality

- Alarm code is displayed on the master controller/ the 7-segment of O.U. display PCB / the 7-segment of I.U. PCB1.
- This alarm code is indicated when a short circuit (less than 0.24kΩ) or disconnection (more than 840kΩ) of the thermistor is detected during the heating or cooling operation. The operation is automatically restarted when the malfunction is removed.
- Reset the unit to release the alarm.
- The thermistor sensor is connected to the ODU PCB (Hydro Split / Integra Unit).



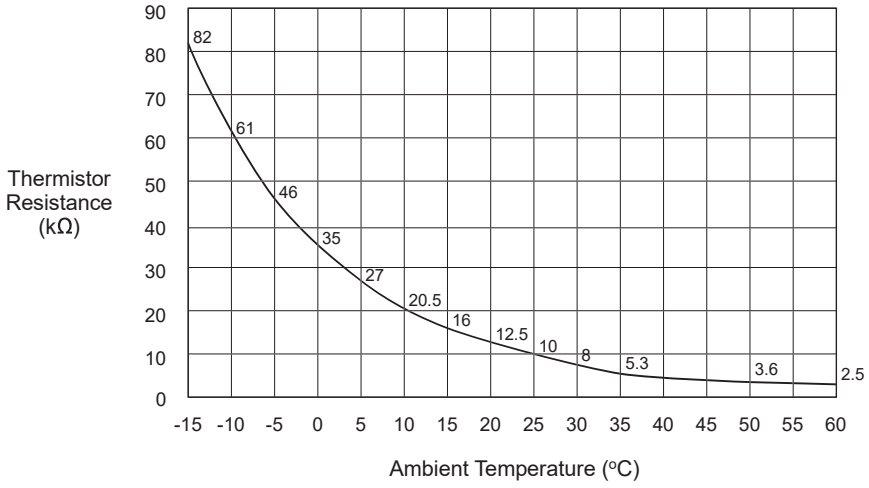

Thermistor Characteristics