Alarm Code 57	Abnormality of Fan Motor

- Alarm code is displayed on the master controller/ the 7-segment of O.U. display PCB / the 7-segment of I.U. PCB1.


★ When the following condition occurs, the fan motor restarts operation automatically after 10 seconds (During this, the compressor continues to operate). If this occurs again nine times in the next five minutes, this alarm code is displayed. This alarm is caused by locking or electrical abnormality of the fan motor.

Condition of Activation:

(1) 044-080 units: Abnormal speed of Fan-motor detection (Cause code of inverter stoppage = 28).

(2) 100-160 units: If the revolution of the fan motor is less than 10rpm 10 seconds after the fan motor starts operation, the fan motor stops.

044-080 units

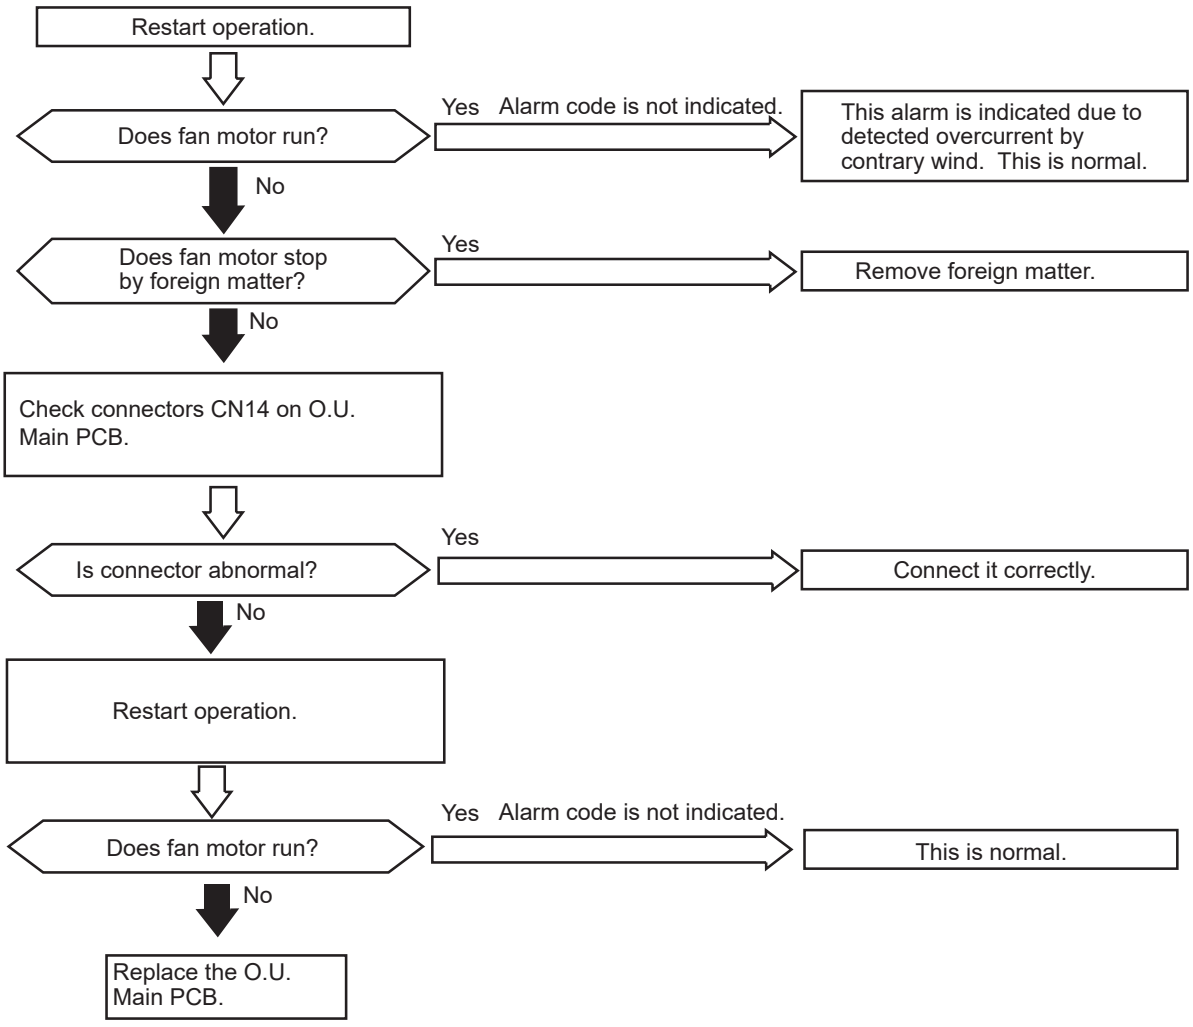

100-160 units

