

Alarm Code 22	Abnormality of Thermistor for Outdoor Unit Ambient (Ta)

- Alarm code is displayed on the master controller/ the 7-segment of O.U. display PCB / the 7-segment of I.U. PCB1.

★ This alarm code is indicated when a short circuit (less than 0.2kΩ) or disconnection (more than 500kΩ) of the thermistor is detected during the operation.

O.U. main PCB: Outdoor Unit main PCB

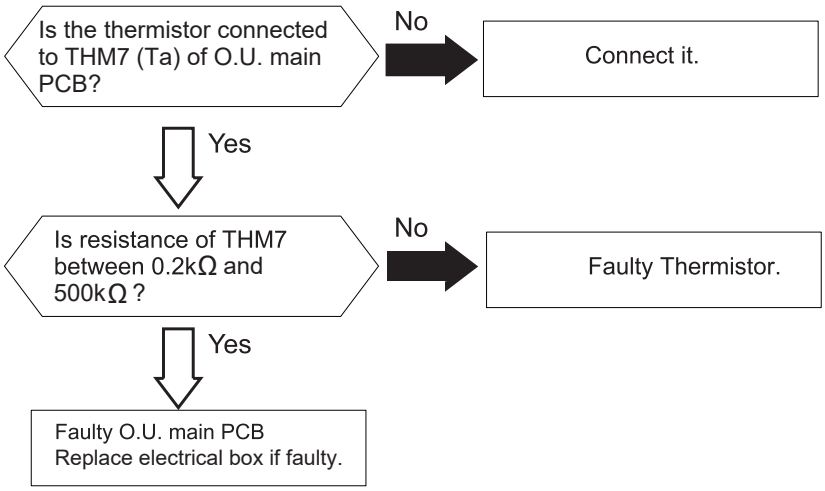

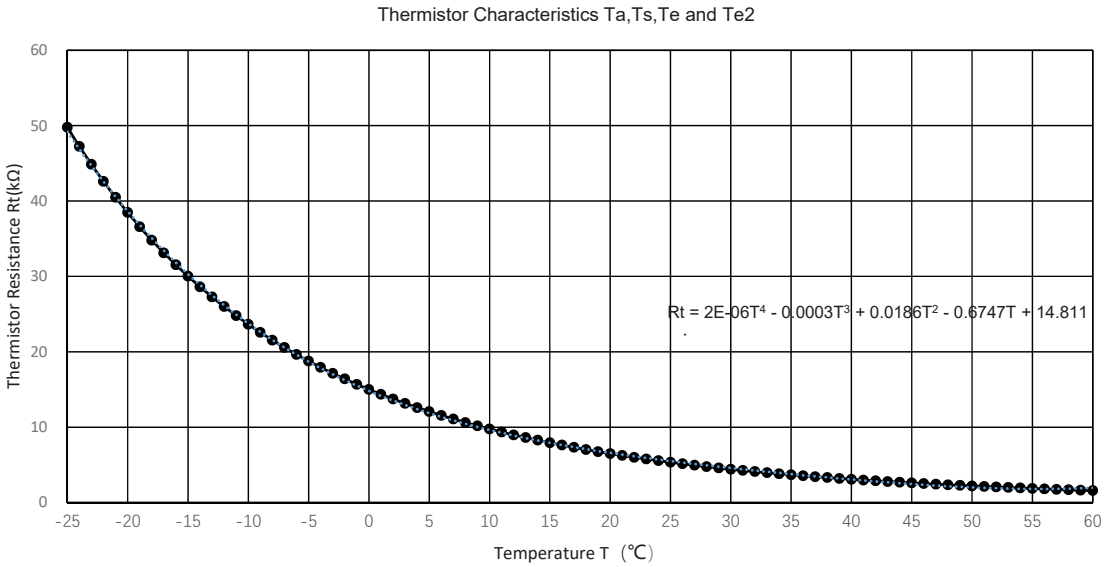

Phenomenon	Cause	Check Item	Action(Turn OFF Main Switch)
Faulty Thermistor for Outdoor Unit Ambient	Fault	Check resistance.	Replace thermistor if faulty.
	Incorrect Connection	Check wiring to O.U. main PCB.	Repair wiring and connections.
Faulty O.U. main PCB		Replace O.U. main PCB and check operation.	Replace O.U. main PCB if faulty.