

Alarm Code 24	Abnormality of Thermistor of heat exchanger Liquid Pipe (Te)

- Alarm code is displayed on the master controller/ the 7-segment of O.U. display PCB / the 7-segment of I.U. PCB1.

★ This alarm code is displayed when a short circuit (0.24kΩ or less) or disconnection (500kΩ or more) of the thermistor is detected during heating or cooling operation.

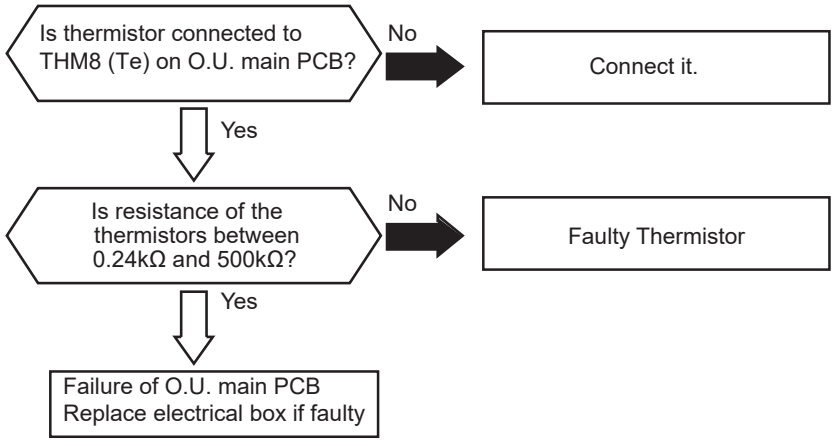

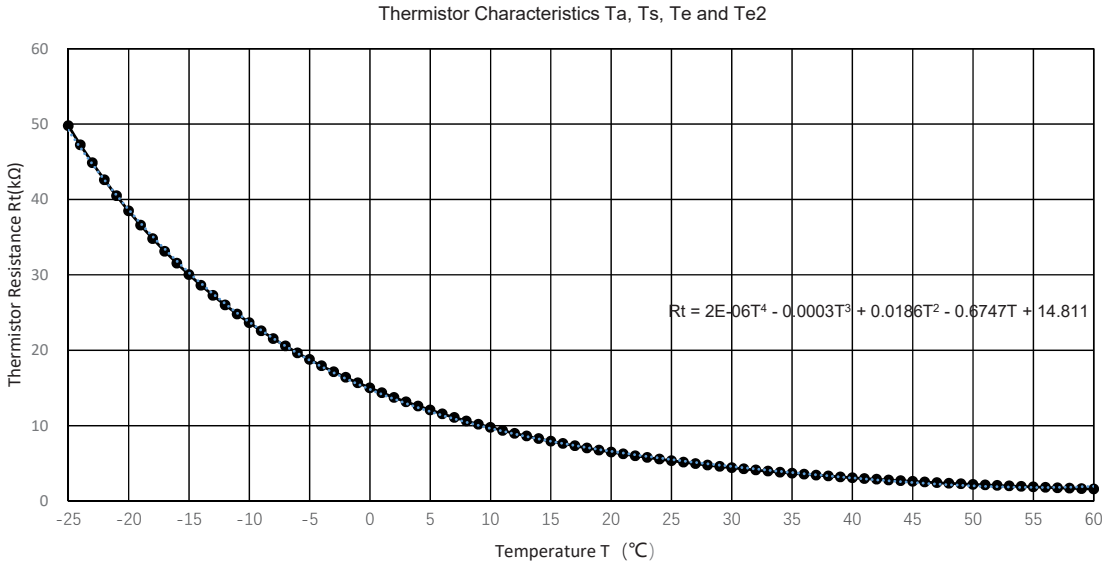

Phenomenon	Cause	Check Item	Action(Turn OFF Main Switch)
Faulty Thermistor for Heat Exchanger Liquid Pipe(Te)	Fault	Check resistance.	Replace thermistor if faulty.
	Incorrect Connection	Check wiring to O.U. main PCB.	Repair wiring and connections.
Faulty O.U. main PCB		Replace O.U. main PCB and check operation.	Replace O.U. main PCB if faulty.